

DAVID C. LONG
ATTORNEY AT LAW
EXECUTIVE BUILDING-P.O. BOX 427
300 FOURTH STREET
ELYRIA, OHIO 44036

HWEB
can needs to speak
to person who collected report

146393

TELEPHONE
216/323-3331

July 24, 1985

Director, Waste Management Division
United States Environmental
Protection Agency, Region V (5HR)
230 South Dearborn Street
Chicago, IL 60604

Re: United States of America
vs.
Chemical Recovery Systems, Inc.
United States District Court
Northern District of Ohio
Eastern Division
Case NO: C80-1858

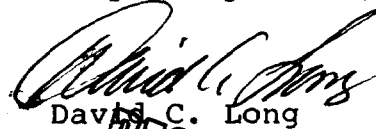
Dear Sir:

Enclosed please find the final testing report required by the consent decree in the above captioned case. My client indicates that the results of that testing are all within acceptable limits.

I am therefore requesting that your office review the testing report and issue your notice that the remedial and monitoring provisions of the consent decree have been completed thus terminating the action pursuant to section X of the consent decree. In reviewing the decree you will find that a sixty (60) day time period is allotted for issuance of your notice.

Thank you very much for your consideration in this matter.

Very Truly Yours,


David C. Long

DCL/cm

cc: Mr. James Freeman
Anthony Giardini, Esq.
Mr. Joseph Heimbuch
Mr. Russell Obitts
Mr. Peter Shagena
Kathleen Sutula, Esq.

RECEIVED
AUG 1 1985
U.S. EPA, REGION V
WASTE MANAGEMENT DIVISION
HAZARDOUS WASTE ENFORCEMENT BRANCH



HYDRO RESEARCH SERVICES
Water Management Division
Clow Corporation

408 Auburn Avenue
Pontiac, MI 48058

313 334-1630
313 334-4747

Chemical Recovery of Ohio
36345 Van Born Road
Romulus, MI 48174
Attn: Mr. Pete Shagena
Samples received: 5/17/85

Client I.D.: Downstream, Sewer Outfall, Upstream

Hydro Numbers: 92593-92595

Methodology: PCB's - EPA Method 608
Volatile Organics - Gas
Chromatography/Mass
Spectroscopy-Method 624

Data Submitted: 7/2/85

Susan K. Scott
Laboratory Supervisor



HYDRO RESEARCH SERVICES
Water Management Division
Clow Corporation

408 Auburn Avenue
Pontiac, MI 48058

313 334-1630
313 334-4747

Chemical Recovery of Ohio
36345 Van Born Road
Romulus, MI 48174
Attn: Mr. Pete Shagena

July 2, 1985

Sample received: 5/17/85

Hydro Numbers:	92593	92595	92594
----------------	-------	-------	-------

Client I.D.	Down- stream	Sewer Outfall	Upstream
-------------	-----------------	------------------	----------

Analysis performed by gas chromatography.

PCBs, mg/l as

Aroclor 1242	<0.05	<0.05	<0.05
Aroclor 1254	--	--	--
Aroclor 1260	0.20	0.60	<0.05

Susan K. Scott
Laboratory Supervisor



HYDRO RESEARCH SERVICES
Water Management Division
Clow Corporation

408 Auburn Avenue
Pontiac, MI 48058

313 334-1630
313 334-4747

Chemical Recovery of Ohio
36345 Van Born Road
Romulus, MI 48174
Attn: Mr. Pete Shagena

July 2, 1985

PRIORITY POLLUTANT ANALYSIS

Concentration, ug/l

Sample received: 5/17/85

Hydro Numbers:	92593	92594	92595
Client I.D.	Down- stream	Upstream	Sewer Outfall
<u>Volatile Organic Compounds</u>			
Acrolein	<100	<100	<100
Acrylonitrile	<100	<100	<100
Benzene	<10	<10	<10
Bis(Chloromethyl)ether	<10	<10	<10
Bromoform	<10	<10	<10
Carbon Tetrachloride	<10	<10	<10
Chlorobenzene	<10	<10	<10
Chlorodibromomethane	<10	<10	<10
Chloroethane	<10	<10	<10
2-Chloroethylvinyl ether	<10	<10	<10
Chloroform	<10	<10	<10
Dichlorobromomethane	<10	<10	<10
Dichlorodifluoromethane	<10	<10	<10
1,1-Dichloroethane	<10	<10	<10
1,2-Dichloroethane	<10	<10	<10
1,1-Dichloroethylene	<10	<10	<10
1,2-Dichloropropane	<10	<10	<10
1,3-Dichloropropene	<10	<10	<10



HYDRO RESEARCH SERVICES
Water Management Division
Clow Corporation

408 Auburn Avenue
Pontiac, MI 48058

313 334-1630
313 334-4747

PRIORITY POLLUTANT ANALYSIS

Concentration, ug/l

July 1, 1985

Sample received: 5/17/85

Hydro Numbers:

92593

92594

92595

Client I.D.

Down-
stream

Upstream

Sewer
Outfall

Volatile Organic Compounds

Ethylbenzene	<10	<10	<10
Methyl Bromide	<10	<10	<10
Methyl Chloride	<10	<10	<10
Methylene Chloride	<10	<10	<10
1,1,2,2-Tetrachloroethane	<10	<10	<10
Tetrachloroethylene	<10	<10	<10
Toluene	<10	<10	<10
trans-1,2-dichloroethylene	31	<10	<10
1,1,1-Trichloroethane	110	<10	<10
1,1,2-Trichloroethane	<10	<10	<10
Trichloroethylene	29	<10	<10
Trichlorofluoromethane	<10	<10	<10
Vinyl Chloride	<10	<10	<10

Susan K. Scott
Laboratory Supervisor



HYDRO RESEARCH SERVICES
Water Management Division
Clow Corporation

408 Auburn Avenue
Pontiac, MI 48058

313 334-1630
313 334-4747

July 11, 1985

Chemical Recovery of Ohio
36345 Van Born Road
Romulus, MI 48174
Attn: Mr. Pete Shagena

Samples received: May 16, 1985

Field Notes & Observation:

Hydro Numbers:	92593	92595	92594
Client I.D.	Down- stream	Sewer Outfall	Upstream

Weather Conditions:
5/16/85

Overnite and early morning rain, temperature
in the mid 60° F.

Grab samples collected by Hydro Research personnel, Jeff Bolin on
May 16, 1985 between 12 Noon and 1:30 PM.

DAVID C. LONG

ATTORNEY AT LAW

EXECUTIVE BUILDING-P.O. BOX 427

300 FOURTH STREET

ELYRIA, OHIO 44036



Director, Waste Management Division
United State Environmental Protection
Agency
Region V (5HR)
230 South Dearborn St.
Chicago, IL 60604

Handwritten:
65-293-3920
Sutela

